


# UMC Multiple Power Connection/Splice/Tee Kit

Installation Instructions  
For Self-Regulating & Constant Wattage Heating Cables

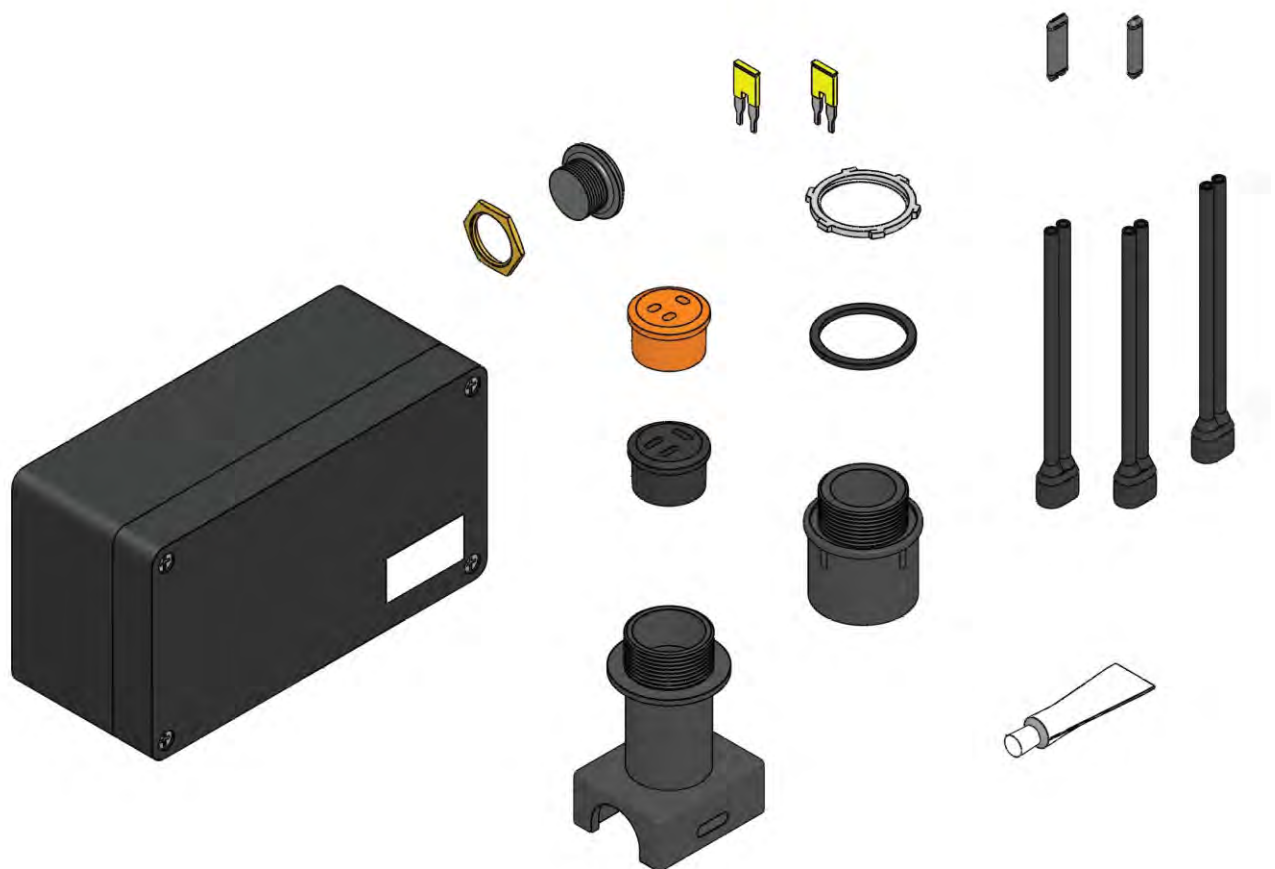


**TRASOR**

PJ497-2  
161-562581-025  
January, 2012



# UMC Multiple Power Connection/Splice/Tee Kit Self-Regulating & Constant Wattage Heating Cable Installation Instructions

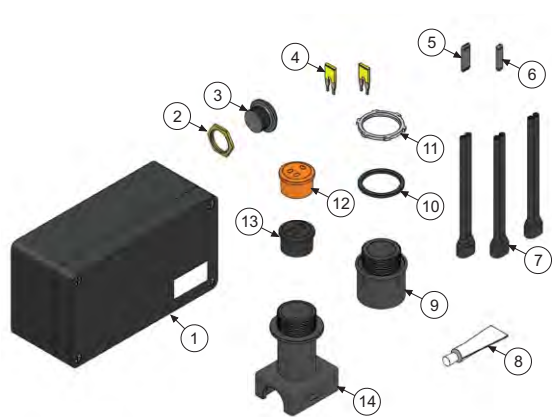

## General

The UMC power connection/splice/ tee kit is used for electrical termination, splice, or tee of self-regulating or constant wattage cables. Each kit contains the terminations needed to make all electrical connections.

Item	Qty	Description
1	1	Junction Box
2	1	Brass Locknut (when used as Splice/Tee)
3	1	Conduit Plug (when used as Splice/Tee)
4	2	Jumper
5	1	Self-Regulating Grommet Insert
6	1	Constant Wattage Grommet Insert
7	3	Silicone Termination Boot
8	1	RTV
9	1	Compression Fitting
10	1	O-Ring
11	1	Locknut
12	1	Constant Wattage Grommet
13	1	Self-Regulating Grommet
14	1	Pipe Standoff

## Certifications & Approvals

IP66 NEMA/Type 4X -60°C < Ta < +55°C  
 Ordinary & Hazardous Locations  
 Class I, Division 2 Groups A,B,C, & D, Zone 2 IIC  
 Class II, Division 2, Groups F & G, Class III




ITS08ATEX36059X CE0389  
 IIG Exe II T6 Ta -60°C ti 170°C  
 IECEx ITS 07.0018X  
 Exe II T6 GbTa -60°C to 170°C

## Tools Required for Kit Installation



## Actual Kit Dimensions

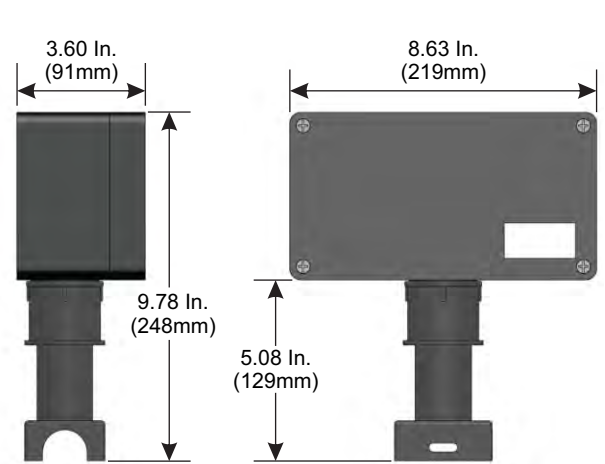

## **⚠WARNING**

**HAZARD OF ELECTRIC SHOCK.** Disconnect all power before opening. All installations must be effectively grounded in accordance with the National Electrical Code to eliminate shock hazard. To avoid electrostatic discharge. Wipe with damp cloth.

## **⚠WARNING**

Turn off power before removing junction box cover at all times.

## **⚠WARNING**

Users should install adequate controls and safety devices with their electric heating equipment. Where the consequences of failure may be severe, back-up controls are essential. Although the safety of the installation is responsibility of the user, Trasor will be glad to assist in making equipment recommendations.

### **Order Separately**


#### **Pipe Straps**

PS-1 - 1/2" to 3/4" pipes  
PS-3 - 1" to 3" pipes  
PS-6 - 3" to 6" pipes  
PS-18 - 6" to 18" pipes



#### **Caution Labels**

EHTL-1 - Single Labels  
EHTL-5 - 5-Pack of EHTL-1

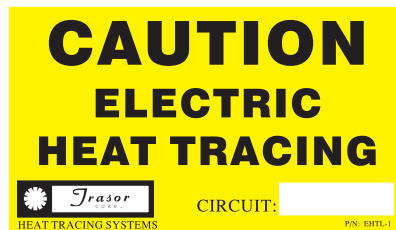

#### **Fiberglass Tape**

FGT-66 - For non-SS pipes & install temp > 40°F  
FGT-66S - For SS pipes or install temp < 40°F




#### **Small Pipe Adapter**


SPA - For mounting to pipes 1-1/2" and smaller



## Cable installation instructions: SRL, SRF, SRME, SRP CWM cable special instructions denoted by \*

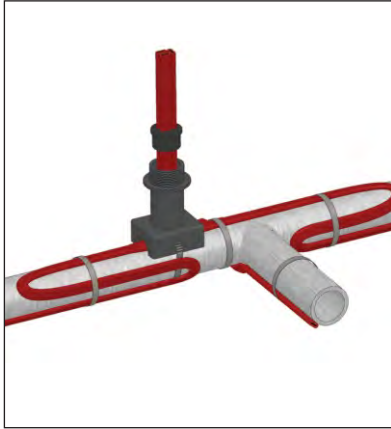


1. Insert heating cable through pipe standoff and grommet as shown. 8 inches of cable should extend past the grommet. If only two cables are entering the kit close off the remaining grommet opening with the appropriate grommet insert. Attach the pipe standoff to the pipe with a pipe strap (Trasor type PS not included) as shown. Attach extra cable to pipe as appropriate. For pipes smaller than 1-1/2" diameter optional small pipe adapter (Trasor model SPA not included) is required.

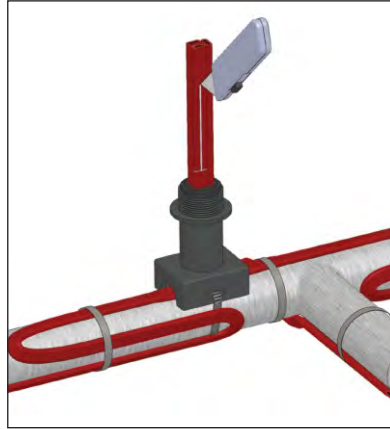


2. Score the outer insulation 7 inches from the end of the cable. Lightly cut the outer jacket up the center to the end of heating cable and remove the outer jacket from the cable. **WARNING: DO NOT CUT METAL BRAID.**


**Note:** If using braid only cable (-C), skip this step.

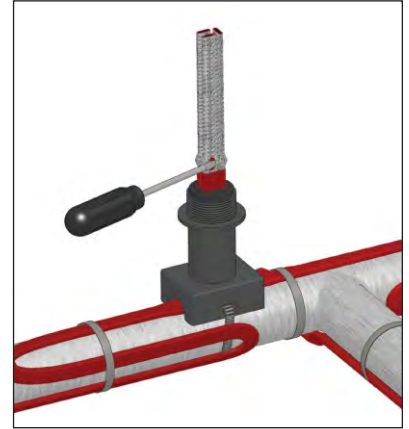


3. Move braid back toward the overjacket, creating a bulge. At the bulge, separate the braid to make an opening.

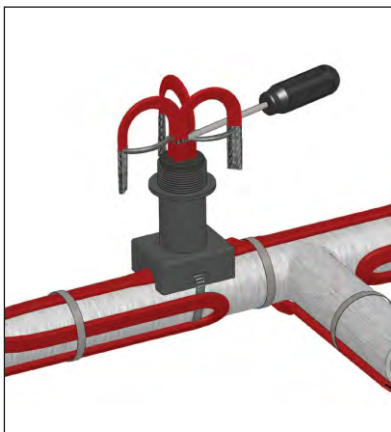

4. While bending the heating cable, work the cable through the braid opening. Pull the braid tight.

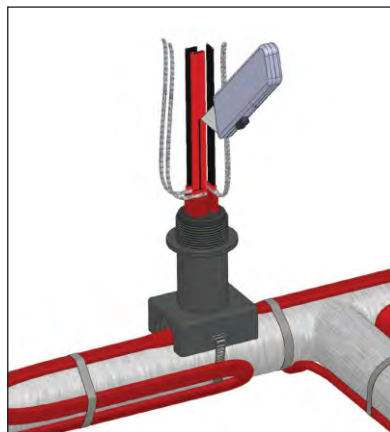


5. Score the inner insulation 6 inches from the end. Lightly cut the inner jacket up the center to end of heating cable and remove the inner jacket from the cable.

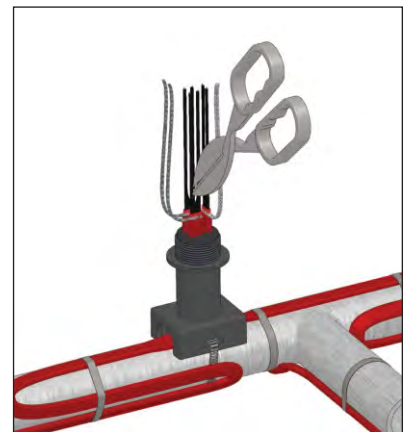


6. Use tin snips or similar tool to cut excess matrix from between the buss wires.

\*Separate CWM leads

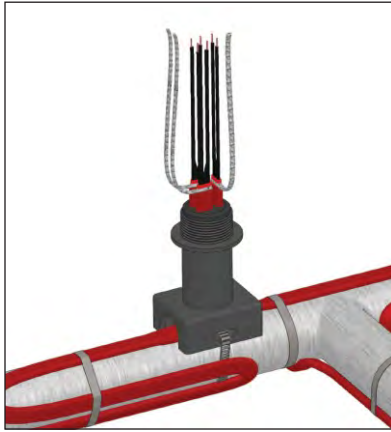


7. Strip each bus wire 1/4".

\*Separate CWM leads and strip 1/4" from each leadwire.

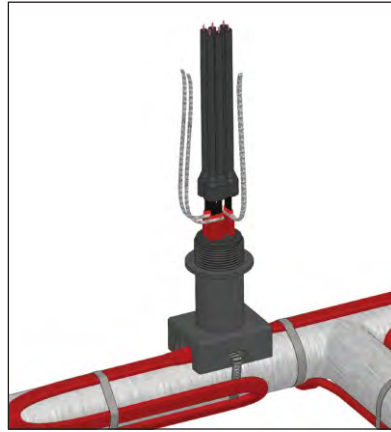


8. Liberally apply RTV over the exposed matrix and leads. Push the rubber boot over the heating cable. Trim lead ends as needed.


\*Boot is not needed when using CWM constant wattage cable.

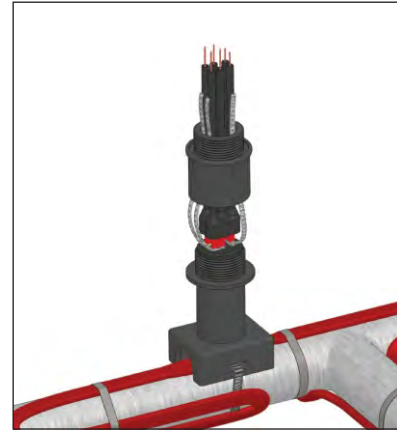


9. Slide compression fitting over cable. Grommet should be placed inside pipe standoff. Termination boot should be spaced 1/2" from sealing grommet. Tighten compression fitting until it bottoms out against pipe standoff.

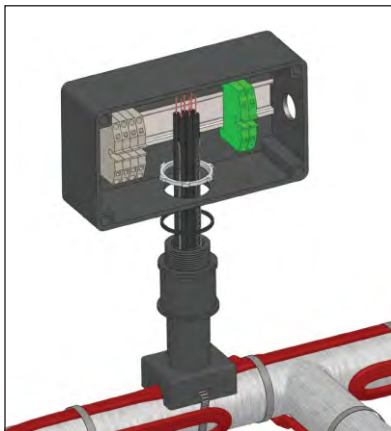

10. Assemble junction box to compression fitting as shown. Tighten locknut until the junction box bottoms out against the lip of the compression fitting.

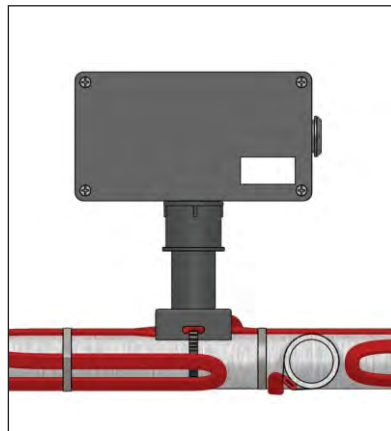

11. Once locknut is secure place cover on box and secure the lid to the box by tightly fastening screws.

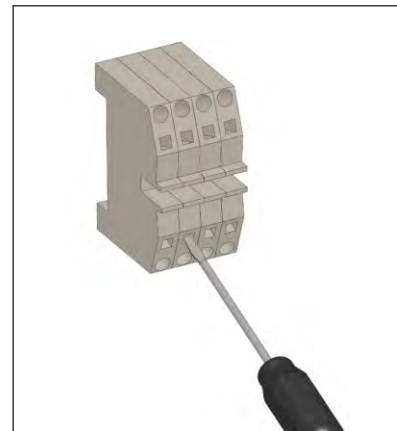


12. Attach 3/4" conduit hub. Use a flat head screwdriver to release the terminal spring clamps and insert cable leads and grounding braid. The UMC multiple entry connection kit can be used as a tee kit or a power connection kit for multiple cables. Please see the electric diagrams below for proper wiring for your application. Attach junction box cover to seal enclosure.


**Note:** The conduit hub should be approved for Class 1, Div. 2; Class II Div. 1 & 2, Class III, Div. 1 & 2, and NEMA 4X rated by a nationally recognized testing laboratory.

## Wiring Diagrams

Tee Connection - Overjacketed Cables

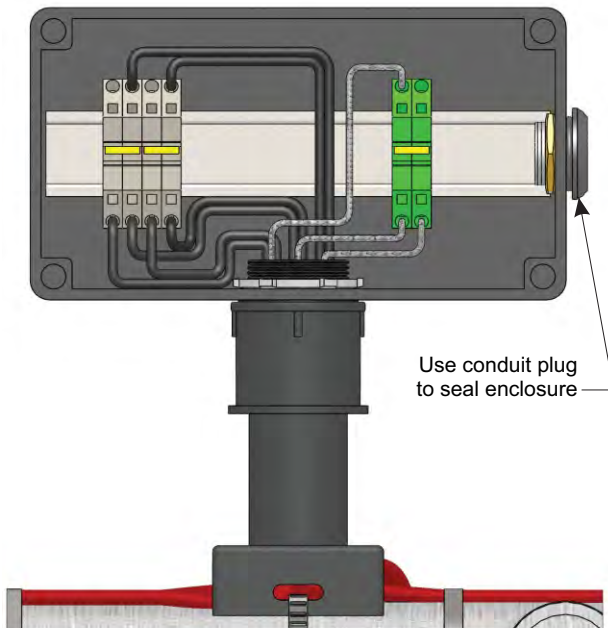

Power Connection - Overjacketed Cables

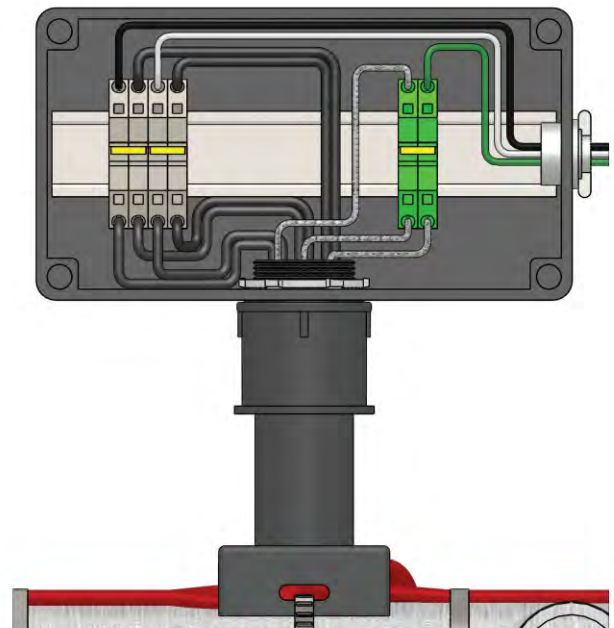



**Electrical Heat Trace Systems**

800-324-1551

[www.trasor.com](http://www.trasor.com)